

Roadview SD1000 and SD1050 DVD Region Error

Some DVD's have Region Code Enhancement software on them. A disc with RCE software will only play on a Region 1 (North America) DVD player. The SD1000 and SD1050 players are manufactured as Region 0, also called a region free player. This allows the player to be shipped and sold anywhere in the world.

Should your Roadview DVD player display a message regarding Region code; follow the instructions below to change your players region code to Region 1.

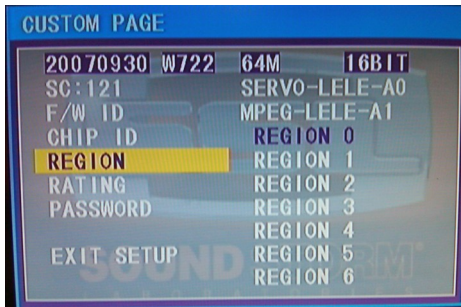


Image and message may appear different

1. Turn your Roadview DVD player and TV on.
2. Load a DVD disc that will play normally and leave the face of radio open.



3. Wait until the disc begins playing. The steps following must be completed quickly before the menu disappears.
4. Press the eject button on the radio and quickly close the radio face plate.
5. Repeatedly press the number "8" button on the remote control. Stop when the screen below is displayed.



6. Quickly press the RIGHT arrow button on the remote to highlight Region 1 in yellow and press ENTER.





Roadview SD1000 and SD1050 DVD Region Error

7. If you were quick enough, the DVD player is now set as a Region 1 DVD player. It is now capable of playing all your DVD movies; including DVD discs with RCE software.
8. Open the radio face and press the EJECT button to remove your disc.
9. Loading a DVD that previously would not play to confirm it will now play.
10. If a DVD with RCE will still not play, repeat steps 2 - 6. Because the menu closes so quickly it may take you several attempts to complete the task.

To learn more about DVD Region Code and RCE, visit the following website.

http://en.wikipedia.org/wiki/DVD_region_code